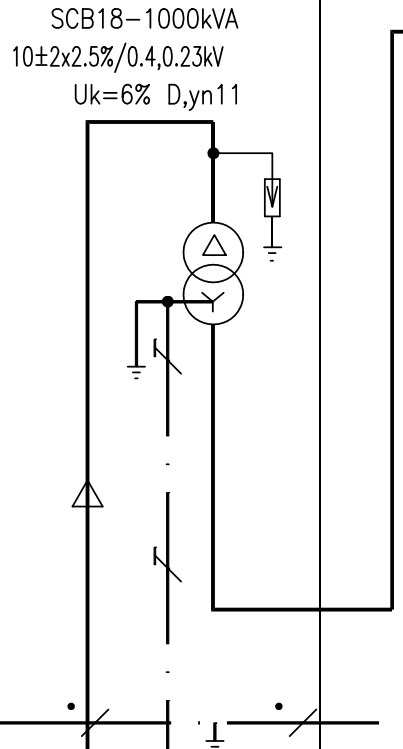
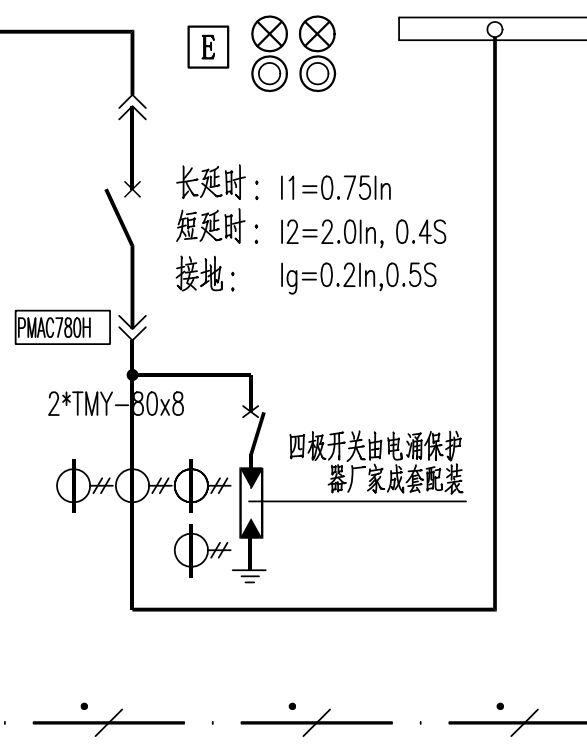
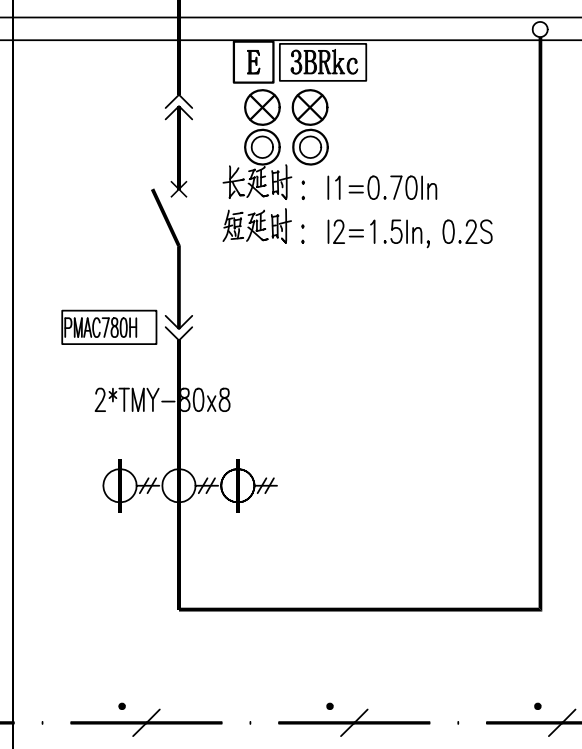
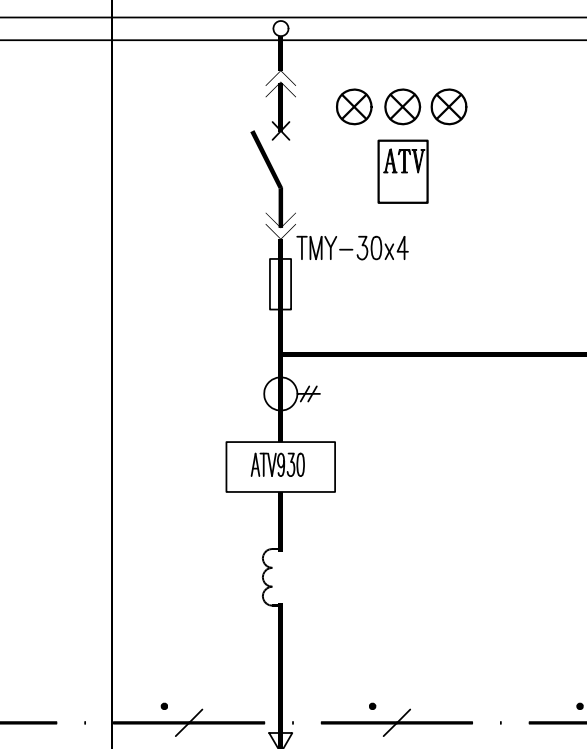
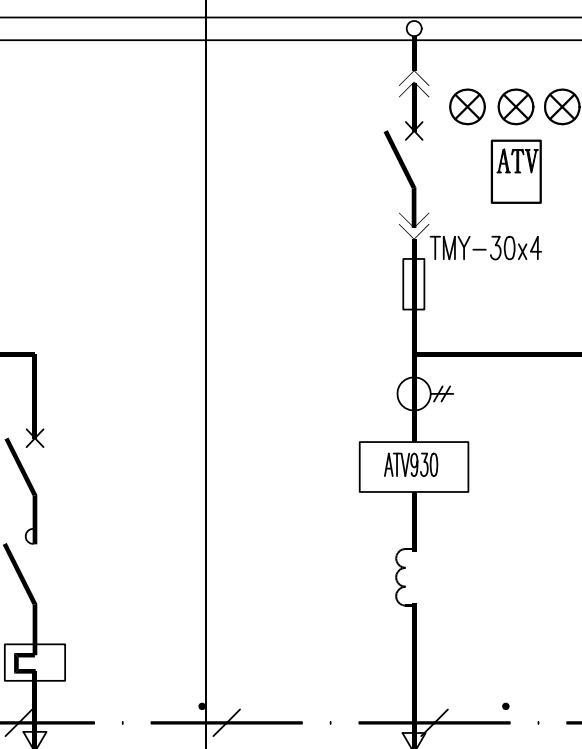


1		2		3		4		5		6		7		8		
A	相 母 线 截 面		3-TMY-125x10												A	
	N 母 线 PE 母 线		TMY-80x8 TMY-80x8												B	
	盘 编 号/盘 宽*深*高				AA01/1000*1000*2200		AA03/1000*1000*2200		AA05/800*1000*2200		AA07/800*1000*2200				C	
B	回 路 编 号/二 次 接 线 图 号				1/		1/		1/低压控制原理图5.1		1/低压控制原理图5.1				D	
	框 架 断 路 器				MTZ2 20 H1b/4P Micrologic 6.0X 2000A		ATMT 3RCK MTZ2 20 H1b/4P Micrologic 6.0X 2000A								E	
	塑 壳 断 路 器								NSX400H MIC2.3 400 3P P+OF+SD		NSX100H TMD16 3P OF+SD		NSX400H MIC2.3 400 3P P+OF+SD		NSX100H TMD16 3P OF+SD	
C	接 触 器										LC1D09M7C+LADN22C		LC1D09M7C+LADN22C		F	
	热 继 电 器										LRD05C		LRD05C			
	快 速 熔 断 器								NGTC3-500A				NGTC3-500A			
A2	多 功 能 仪 表				PMAC780H-V2-SD-PS		PMAC780H-V2-SD-PS									
	变 频 器+输 出 电 抗 器								ATV930C16N4C+VW3A5307		ATV930C22N4C+VW3A5106					
	电 动 机 保 护 器 PMAC801A															
	电 流 互 感 器 AKH-0.66 0.5S级 2.5VA				4*( 2000/1A)		3*( 2000/1A)		1*( 500/1A)		1*( 500/1A)					
	浪 涌 保 护 器+后 备 保 护 器				SHK-SCB-I-50/4P+SHK-LYAM-0.4-200/4P											
	无 线 六 点 测 温 装 置				DING-W		DING-W		DING-W		DING-W					
	垂 直 出 线 排															
	出 线 零 排															
	设 备 容 量 （kW）								160kW		0.37kW		200kW		0.37kW	
	回 路 名 称				进 线		母 联		HRS酸循环泵		电 机 配 套 风 扇		干 燥 酸 循 环 泵		电 机 配 套 风 扇	
	回 路 编 号								P-0401A				P-4301			