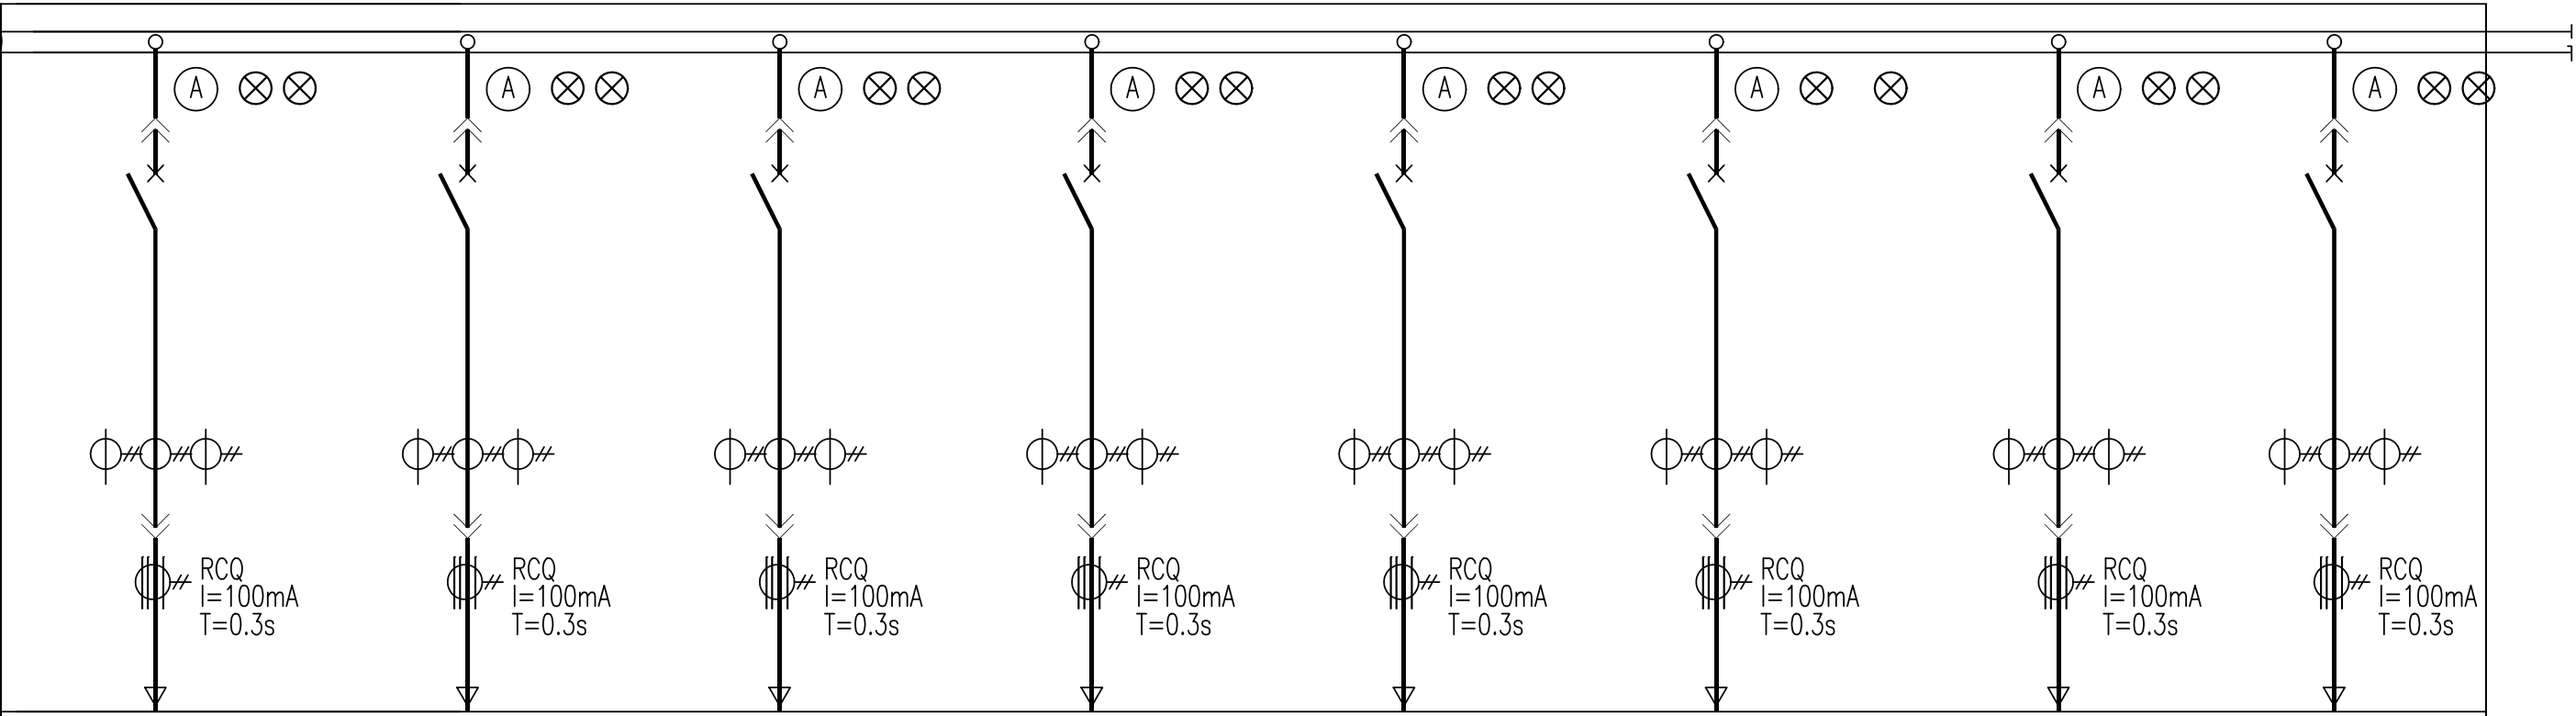


1		2		3		4		5		6		7		8					
A	相 母 线 截 面		3-TMY-125x10												A				
	N 母 线		TMY-80x8																
	PE 母 线		TMY-80x8																
	盘 编 号/盘 宽*深*高		AA33/800*1000*2200																
	回 路 编 号/二 次 接 线 图 号		1/低压控制原理图7		2/低压控制原理图7		3/低压控制原理图7		4/低压控制原理图7		5/低压控制原理图7		6/低压控制原理图7		7/低压控制原理图7		8/低压控制原理图7		
	抽屉单元		8E		8E		8E		8E		8E		8E		8E		16E		
	塑壳断路器/双电源开关/刀熔开关		NSX100H TMD40 3P3D+OF+SD		NSX100H TMD40 3P3D+OF+SD		NSX100H TMD40 3P3D+OF+SD		NSX100H TMD40 3P3D+OF+SD		NSX100H TMD100 3P3D+OF+SD		NSX100H TMD100 3P3D+OF+SD		NSX100H TMD100 3P3D+OF+SD		NSX400H MIC2.3 400 3P3D+OF+SD		
	接触器																		
	热继电器																		
	快速熔断器																		
多功能仪表		SPM32-N-SR-PS		SPM32-N-SR-PS		SPM32-N-SR-PS		SPM32-N-SR-PS		SPM32-N-SR-PS		SPM32-N-SR-PS		SPM32-N-SR-PS		SPM32-N-SR-PS			
B	变频器+输出电抗器																		
	电动机保护器 PMAC801A																		
	电 流 互 感 器 AKH-0.66 0.5S级 2.5VA		3*(40/1A)		3*(40/1A)		3*(40/1A)		3*(40/1A)		3*(40/1A)		3*(100/1A)		3*(100/1A)		3*(400/1A)		
	浪涌保护器+后备保护器																		
	无线六点测温装置										DING-W		DING-W		DING-W		DING-W		
	漏电继电器+零序互感器		SHYS-EG(T)R+ZCT-Φ45		SHYS-EG(T)R+ZCT-Φ45		SHYS-EG(T)R+ZCT-Φ45		SHYS-EG(T)R+ZCT-Φ45		SHYS-EG(T)R+ZCT-Φ45		SHYS-EG(T)R+ZCT-Φ45		SHYS-EG(T)R+ZCT-Φ45		SHYS-EG(T)R+ZCT-Φ45		
	垂直出线排		3*TMY-60*6																
	出线零排		TMY-40*6																
	设 备 容 量 (kW)		40		40		40		40		100		100		100		400		
	回 路 名 称		备 用		备 用		备 用		备 用		备 用		备 用		备 用		备 用		
回 路 编 号																			
C																			
D																			
E																			
F																			